



# 123 SAMPLE REPORT Lane Anywhere CA 00000

Sent: Mon, 19 Aug 2019 15:48

PREPARED BY:

Alex Hamilton

QUESTIONS? CLICK HERE TO GET HELP



## Summary



### WHOLE HOME ESTIMATE:



Prepared for: Micaela Birton | Prepared by: Alex Hamilton.



Item	Pg Action	Price
MASON		
There are typical cracks in the stucco.	13 Patch stucco in noted areas and seal to prevent moisture intrusion.	\$8
	Sub-Total (Mason)	\$8
CARPENTER/HANDYMAN		
There are stains or moisture damage to the subfloor beneath hall bathroom.	26 Replace or repair damaged sub floor .	\$
The door striker plate needs to be adjusted for the striker pin to engage.	33 Adjust noted doors and hardware throughout property to insure they latch correctly and sealed against water and pest intrusion.	\$2
	Sub-Total (Carpenter/Handyman)	\$1,
ELECTRICIAN		
An outlet near the side door does not respond to testing.	16 Fault find and repair noted outlets.	\$
The overhead conductor lines are not properly configured with a drip loop.	19 Have electrician and power company coordinate install as needed.	\$
One or more ceiling lights do not respond and should be serviced.	31 Fault find and repair light fixture.	9
The exhaust fan is functional but noisy.	34 Service noted fan for proper operation.	\$
An electrical connection has been incorrectly made outside of a junction box.	40 Secure splices in a junction box.	\$
	Sub-Total (Electrician)	\$1,6
PAINTER/DRYWALL		
There is moisture staining on the ceiling.	30 After leak detection patch moisture damaged areas noted on the report.	\$
There is moisture staining on the walls and ceiling.	41 After leak detection patch moisture damaged areas noted on the report.	\$
	Sub-Total (Painter/DryWall)	\$1,
PLUMBER		
The water heater is leaking and should be serviced.	22 Service repair leak, or diagnose replacement if necessary.	\$
The water heater is not correctly secured.	22 Install and adjust straps as needed.	\$
The vent pipe is too close to combustible material and should be serviced before the close of escrow.	23 Service call to cut back combustibles and correctly secure flue.	\$
There is an active leak below the hall bath shower.	26 Service to repair leak or change out to correct connections.	\$
The mechanical sink stopper is incomplete and should be serviced.	33 Change out drain stops noted throughout report.	\$
	33 Repair leak at tub valve.	
The tub valves leak when in use.	33 Repair leak at tub valve.	\$



Prepared for: Micaela Birton | Prepared by: Alex Hamilton.

# Item	Pa Action	Price
18 There is a leak below the sink.	Pg Action 34 Service to repair leaks or change out to correct connections.	\$149
19 The shower diverter valve in the tub/shower is defective.	34 Adjust valve to direct all water during operation.	\$149
20 The hot water side of the faucet has very low pressure.	35 Service call to adjust water temperature and fault find problem.	\$160
21 The gas line should be capped at all times when not in use.	38 Install cap on gas line to improve safety.	\$160
21 The gas line should be capped at all times when not in use.		φ1+0
	Sub-Total (Plumber)	\$1,512
HVAC		
22 We recommend all systems be cleaned and serviced by a qualified hvac contractor.	27 Full service and adjustment to get system working more efficiently .	\$475
23 There is what appears to be insulation in one of the registers.	28 Service on ductwork in attic.	\$380
24 Hvac the pan is rusted indicating it held water.	28 Change out drain pan and service drain line to prevent future damage.	\$220
25 Hvac there is likely a leak in the main drain line.	28 Service call to correctly install drain line.	\$230
	Sub-Total (HVAC)	\$1,305
FENCING		<b>0</b> (0)
26 The fences and gates are serviceable, but have damage commensurate with their age.	16 Repair fence in noted areas.	\$484
	Sub-Total (Fencing)	\$484
WINDOW		
<ul><li>27 A window lock is missing and needs to be serviced to be functional.</li></ul>	31 Install new window lock to improve safety.	\$177
28 A window lock is missing, or needs to e serviced, to be functional.	32 Install new window lock to improve safety.	\$177
· · · · · · · · · · · · · · · · · · ·		
	Sub-Total (Window)	\$354
CHIMNEY		
29 The chimney flue needs to be cleaned and evaluated by a specialist before it is used.	29 Full chimney sweep and inspection.	\$350
	Sub-Total (Chimney)	\$350
PEST/MOULD		
30 There is damage to the wood trim, posts, roof eves that should be evaluated by a termite	15 Treat home for wood destroying insects.	\$950
inspector.		
	Sub-Total (Pest/Mould)	\$950

Prepared for: Micaela Birton | Prepared by: Alex Hamilton.



# Item	Pg	Action	Price	
GARAGE DOOR			\$210	
31 The garage door hardware has been unprofessionally repaired or modified.	41 Service call to adjust	41 Service call to adjust garage door and repair noted items.		
	Sub-Total (Garage I	Door)	\$210	
CONCRETE CONTRACTOR				
32 There are several offsets in the walkways that could prove to be trip hazards.	15 Grind area to improve	e safety or use mud jacking to level out.	\$550	
	Sub-Total (Concrete	Contractor)	\$550	
HOME OWNER REPAIR				
33 There is no wrench at the gas shutoff valve to facilitate an emergency shutoff.	21 Purchase and secure	wrench near valve for added safety	\$68	
	Sub-Total (Home O	vner Repair)	\$68	
FURTHER ACTION REQUIRED				
34 Microbial growth is present.	41 Mold detection with a	licensed indoor air quality specialist.	\$566	
	Sub-Total (Further /	Action Required)	\$566	

## Thank you for choosing Repair Pricer

#### **About Repair Pricer**

Repair Pricer is the industry standard for converting inspection reports into accurate repair estimates during the complex home purchasing process, enabling all parties to act quickly and confidently during a critical period. Repair Pricer saves time and reduces stress for everyone when it matters most. To learn more about Repair Pricer, visit www.repairpricer.com



It is important you understand that the service provided by RepairPricer.com is purely for estimation and negotiation purposes. We do not guarantee that the prices we estimate for repairs on your report are the same that you will end up paying for that specific repair. Our pricing is based on the average cost for a similar repair in your area, and due to unknown factors or underlying issues that we are not privvy to, actual repair cost may be substantially higher.